

Priority 3 Issue

Insufficient cycle facilities provided on Carmanhall Road which is considered a main spine road within business district.

Recommendation

Provide cycle facilities on both side of Carmanhall Road to tie into existing cycle facilities.



Priority 2 Issue

No cycle facilities provided for northbound cyclists from Burton Hall Road to Blackthorn Avenue which may lead to cyclists continuing on footpath.


Recommendation

Provide a contraflow cycle track on the western verge of Blackthorn Avenue.



Legend

- Two-way cycle facilities
- Cycle facilities on both sides
- Cycle facilities on one side
- No Cycle facilities
- Cycle facilities through public area
- - Proposed scheme
- Shared use area with bicycle bays
- Luas Stop with bicycle racks
- Sports ground
- T Toucon crossing provided
- NT No toucon crossing provided
- P Roadside cycle stands

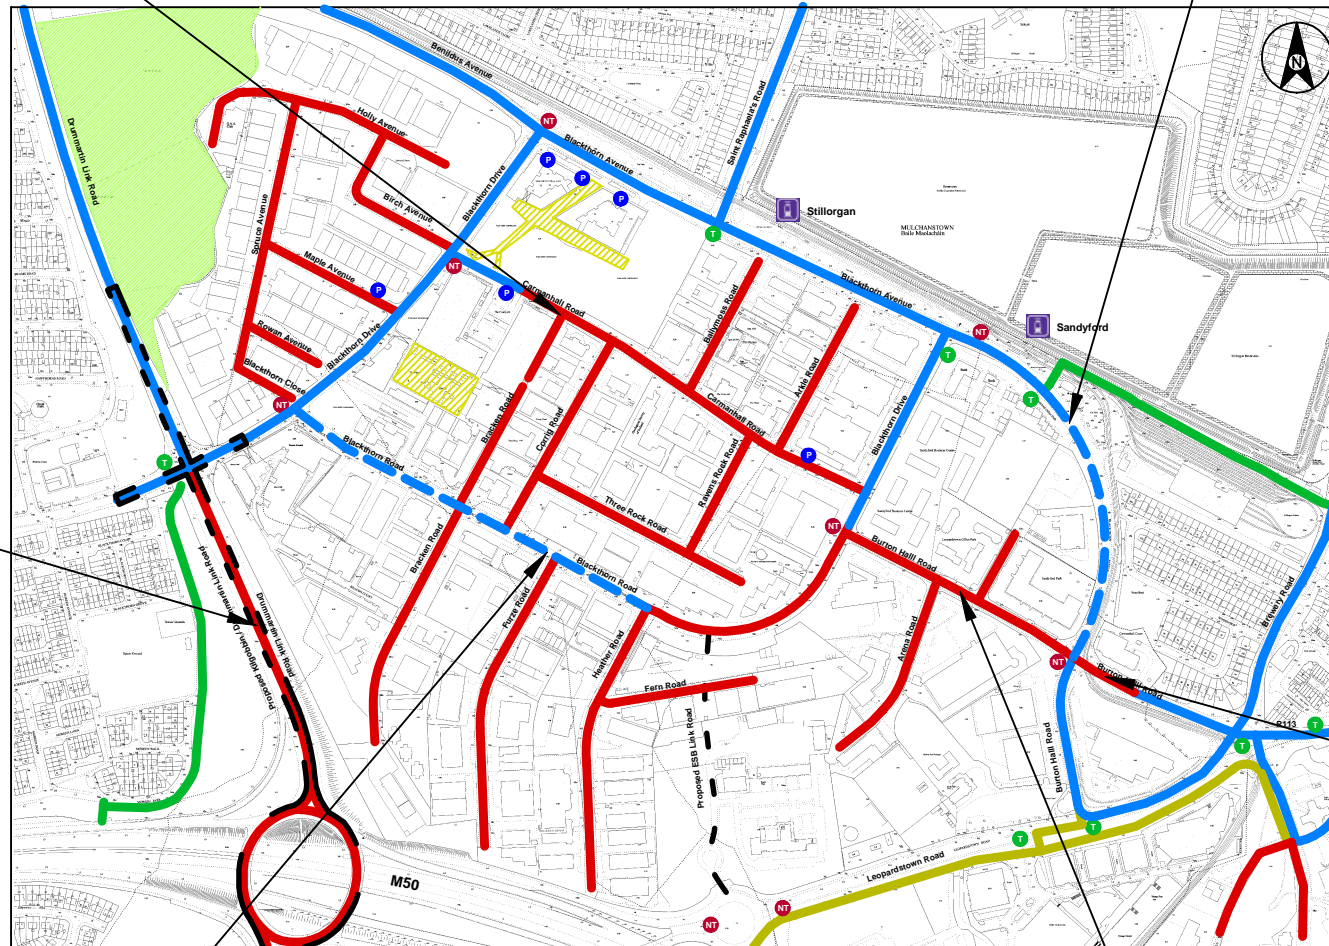

Priority 1 Issue

No cycle facilities provided on Drummartin link road from its junction with Blackthorn Drive continuing south over the M50.

Recommendation

Provide cycle facilities on Drummartin Link Road from existing facilities on Kilgobbin Road to the south and north of the Blackthorn Drive signalised junction.



Priority 1 Issue

Short section of road with no cycle facilities provided between existing cycle facilities. Facility changes in quick succession from cycle track to shared use surface and no cycle facilities for cyclist on Blackthorn Avenue travelling east on Burton Hall Road.

Recommendation

Relocate Bus bay and provide continuous cycle facilities on Burton Hall road.

Priority 2 Issue

No cycle facilities provided on Blackthorn Road which is considered a main spine road within business district. Several cyclists identified cycling on grass verge on southern side of road where there is a risk of slips and falls.

Recommendation

Provide cycle facilities on both side of Blackthorn Road to tie into existing cycle facilities.



Priority 1 Issue

No cycle facilities provided on Burton Hall Road between it junctions with Blackthorn Avenue and Blackthorn Road. Several cyclists identified cycling on grass verge on southern side of road.

Recommendation

Provide cycle facilities on both side of Burton Hall Road to tie into existing cycle facilities.



Client:



Rev.	Comment	Date
3.0	Final	07/03/19
2.0	Draft	06/09/18
1.0	Draft	03/09/18

Notes:

- 1 Do Not Scale - use figured dimensions only.
2. Drawing is the property of PMCE Ltd.
3. OS Map is property of Sandyford Business District

Project:

**Sandyford Business District
Cycle Infrastructure Review**

Drawing Title:

Discontinuous Cycle Facilities

Drawn:

MAH

Checked:

DOB

Approved:

DOB

Drawing No:

P18-055-DG-002

Date:

07/03/2019

Scale:

NTS A3

Status:

Draft

Revision:

D3